

Lantronix, Inc. 10900 Red Circle Drive Minnetonka, MN 55343

www.transition.com / www.lantronix.com

SESPM1040-541-LT-xx Release Notes

Date: December 16, 2021

Version: 3.1.0.1

Overview

This release note covers the requirements, important notes, new features and changes, addressed issues and known limitations for the Self-Enclosed Managed Hardened Gigabit Ethernet PoE++ Switch.

Firmware version 3.1.0.1 and these release notes apply to the following products:

- SESPM1040-541-LT-AC-xx (Rev G and later hardware)
- SESPM1040-541-LT-PD (Rev G and later hardware)
- SESPM1040-541-LT-DC (Rev G and later hardware)
- SESPM-2P-24V-CP

Requirements:

Access to the management info for the SESPM1040-541-LT-xx is available using the Web UI on a desktop or laptop with Windows OS or Linux distro, NFC on a smartphone or tablet with Android OS, BLE on a smartphone or tablet with Android OS, or Command Line Interface (CLI) via the console port or SSH. Management is also available via SNMP.

New Features and Enhancements:

NOTE: This release **DOES NOT** support Self-Enclosed Managed Hardened Gigabit Ethernet PoE++ Switch model numbers with hardware revisions before G.

This release **DOES** provide support for Self-Enclosed Managed Hardened Gigabit Ethernet PoE++ Switch model numbers with hardware revision beginning at G:

SESPM1040-541-LT-AC-xx
 Self-Enclosed PoE++ Switch w/region-specific AC power cord

SESPM1040-541-LT-PD Self-Enclosed PoE++ Switch, PoE Powered version
 SESPM1040-541-LT-DC Self-Enclosed PoE++ Switch, DC Powered version

Units having hardware revision H and desiring to downgrade to earlier firmware v3.0.3 should do so by installing firmware v3.0.3, <u>not</u> by using the firmware swap feature.

Units with hardware revisions beginning with "J" ship with firmware v3.1.0.1 and later and should not downgrade to older firmware.

This release includes the following enhancements:

- Added NAND driver to support replaced EOL NAND component
- Fixed bug causing DHCP to continuously request client IP address when already assigned
- Show proper number of ports with or without use of Additional Combo Port Module/24V
 Passive PoE Module

Related Documentation:

- Self-Enclosed Managed Hardened Gigabit Ethernet PoE++ Switch Install Guide (33772)
- Self-Enclosed Managed Hardened Gigabit Ethernet PoE++ Switch Operation Guide (33773)



Lantronix, Inc. 10900 Red Circle Drive Minnetonka, MN 55343

www.transition.com / www.lantronix.com

- Self-Enclosed Managed Hardened Gigabit Ethernet PoE++ Switch Quick Start Guide (33783)
- SESPM-2P-1G-CP Additional Combo Port Module Option Install Guide (33779)
- SESPM-4P-DIG Digital Input/Output Module Install Guide (33776)
- Switch Manager Mobile App User Guide (33789)
- SESPM-2P-24V-CP 24V Passive PoE Module Install Guide (33829)

Known Limitations:

- Hardware Rev G or later units ship with firmware version 3.x.x.x or later. DO NOT attempt to load older firmware versions 2.x.x.x on units with Hardware Rev G or later.
- Hardware Rev H can use older firmware v3.0.3 but will need to install a new copy of v3.0.3. DO
 NOT use the firmware swap feature to downgrade to v3.0.3.
- Hardware Rev J or later ship with firmware version 3.1.0 or later. DO NOT attempt to load older firmware on these versions.
- Changing PVLAN on Port 6 may require disabling/enabling the port to restore proper functionality.
- The character # should not be used in any text fields.
- Flow Control is off by default. There is no user interface to change this.
- Spanning Tree is on by default. There is no user interface to change this.
- When the switch is powered up there is no output on the console port for over a minute as the switch reboots.
- Changing system name from web UI or through Restore System Configuration, user must change views in CLI for the change to show in CLI prompt.
- Digital I/O port descriptions cannot contain a space character. Port description may save but will not restore properly.
- When running with a management VLAN configuration on a VLAN other than 1, "reload defaults" also requires "copy running-config startup-config" and "reload cold" to restore connectivity to the default IP address.
- On Port VLAN Configuration Web UI page, when configuring ports, configure port individually and press "Apply" before configuring next port.
- When applying a VLAN configuration via NFC, the Allowed Access VLANs list on the Port VLAN
 Configuration page is not updated but the VLAN config does take effect. The unit will be
 manageable and use the specified VLAN. Once in the Web UI, add the VLAN to the Allowed
 Access VLANs list manually and press Apply.
- Cable diagnostics only works when the remote end of the cable is disconnected. Cable diagnostics should be run on 3 or less ports simultaneously.
- Cannot configure ports in different PVLANs.
- Functionality for SESPM-2P-24-CP Passive PoE Module was added with firmware v3.0.1. Firmware versions prior to v3.0.1 do not support passive PoE. If downgrading from v3.0.1 to an earlier firmware with SESPM-2P-24-CP installed, the switch must be power cycled to ensure passive power is fully disabled.
- Port 6 using Optional Combo Port Module (SESPM-2P-1G-CP) supports 10/100/1000Base-T or 1000Base-X SFPs only; it does not support 100Base-X SFPs. If



Lantronix, Inc. 10900 Red Circle Drive Minnetonka, MN 55343

www.transition.com / www.lantronix.com

using 10Base-T or 100 Base-T peers with the copper interface, auto negotiate may require disable/re-enable.

- Port 6 using Optional Combo Port Module with 1G fiber interface may lose link if disabled then re-enabled; a reboot is required to re-establish.
- Port descriptions need to have a set value before attempting to apply a backup which has port descriptions set.
- If syslog server still sends messages after disabling, a reboot may be required.
- If syslog does not work after a restore, re-configure the syslog server by applying the same IP address to start the syslog server.