



SISPM1040-3248-L Release Notes

Date: Mar.22, 2019

Version: 8.40.684

Overview

This release notes covers firmware version v8.40.684 for SISPM1040-3248-L.

Release Changes and Enhancements

Firmware Version: v8.40.684

New feature & Changes

-
- * Disable SSH SHA-1 for security enhancement.
 - * Remove default multicast 224.0.0.1 entry from ACL status.
 - * Add SCP feature.
 - * Remove Force Cool Restart from WebUI.
 - * Remove "reload cold" command from CLI.
 - * Remove the "snmp-server location" command.
 - * Remove OSFP feature.

[Fixed]

-
- * Show error when creating IP route over 32 entries.
 - * Only send the first IP interface address for the switch in the LLDP packet.
 - * All switches are using the same client ID in the DHCP option 61, it will cause only one switch can get IP from windows server 2012/2016, others will run dhcp handshake and decline repeatedly.
 - * Can't get temperature status and power status via private MIB.
 - * DHCP server configuration doesn't show in the running-config, and it cannot be kept after reboot.

Known Limitations and Restrictions

Traffic is leaking from one private VLAN to other VLANs.